


S99 Technical Data

Heavy Duty OPP Acrylic Packaging Tape

Product Composition

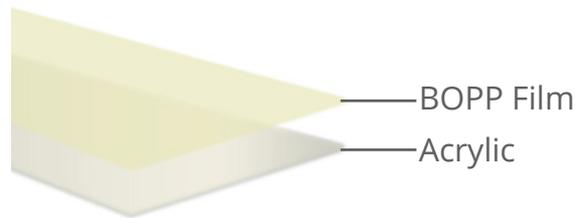

Colours



Description	Heavy Duty BOPP Film with Acrylic Adhesive
Features/Benefits	Strong adhesion Good clarity Good age resistance Sticks to rough or smooth surfaces
Areas of Use	Carton sealing Sealing on recycled cardboard Cold temperature food packaging
Applicable Industries	Packaging Transport/shipping Retail Food packaging
Standard Sizes Available	24mm x 100m = 72 Rolls/Carton 36mm x 100m = 48 Rolls/Carton 48mm x 100m = 36 Rolls/Carton 72mm x 100m = 24 Rolls/Carton
Slitting Options	Custom slit available on request

Backing (Liner)	BOPP Film
Adhesive Type	Acrylic
Tensile Strength N/25mm	91
Elongation at Break %	143
Temperature Resistance °C	70
Adhesion to Stainless Steel N/25mm	9.0
Total Thickness (mm)	0.050 (50 Microns)

The figures above are based off average results from multiple tests, results may vary + or - 5%

Conditions of Use

For best results apply self adhesive tapes between 15°C and 25°C in a dry environment. Application surfaces must be dry and free from dust and particles. Do not apply on surfaces treated or contaminated by anti-adhesives. Avoid contact with surfaces containing plasticizers or other chemical agents not compatible with the tape. In cases of rough or irregular surfaces, it is better to use a tape with a higher quantity of adhesive. Care must be taken with reference to removability without residue and working conditions of the self adhesive tape.

Tape Storage

Ideally store tape between 15°C and 25°C with a maximum relative humidity of 65%. Always store away from heat sources, avoiding exposure to light and if possible keep in the original packaging. When temperatures are lower than 15°C it is highly recommended to recondition the adhesive tape to normal temperatures (15°C to 25°C) before use.

Tape Shelf Life

Self-adhesive tapes technical features are generally not permanent but remain at their best for approximately 12 months, if stored according to suggested conditions and by avoiding extreme environmental conditions such as quick and sudden temperature changes, exposure to UV light and high levels of humidity.

All test methods are based on ASTM standards and Pomona's standardised test methods. The information provided above is based on our experience and tape industry knowledge. It is given in good will but is not intended as a guarantee or a warranty. All end users should ensure for themselves that the product is suitable for their own particular application before using. NB: Peak Force Test: based on ASTM 3759/D ASTM 3759/M and Pomona® test methods, Peel Test: based on ASTM D3330 and Pomona® test methods.